

# MONUMENT RECORD


Corner I.D. #

Q-14

STATE OF INDIANA - COUNTY OF MONROE

Section Twenty-three 23, Township 9 North, Range 1 East

Monument Description & Remarks: Found stone, rounded and nearly flush to  
ground, .8' x .3', exposed .15' out of ground, @ the NW Corner of SW 1/4  
NW 1/4. Steel fence post driven next to stone. Witnessed 6/14/83.

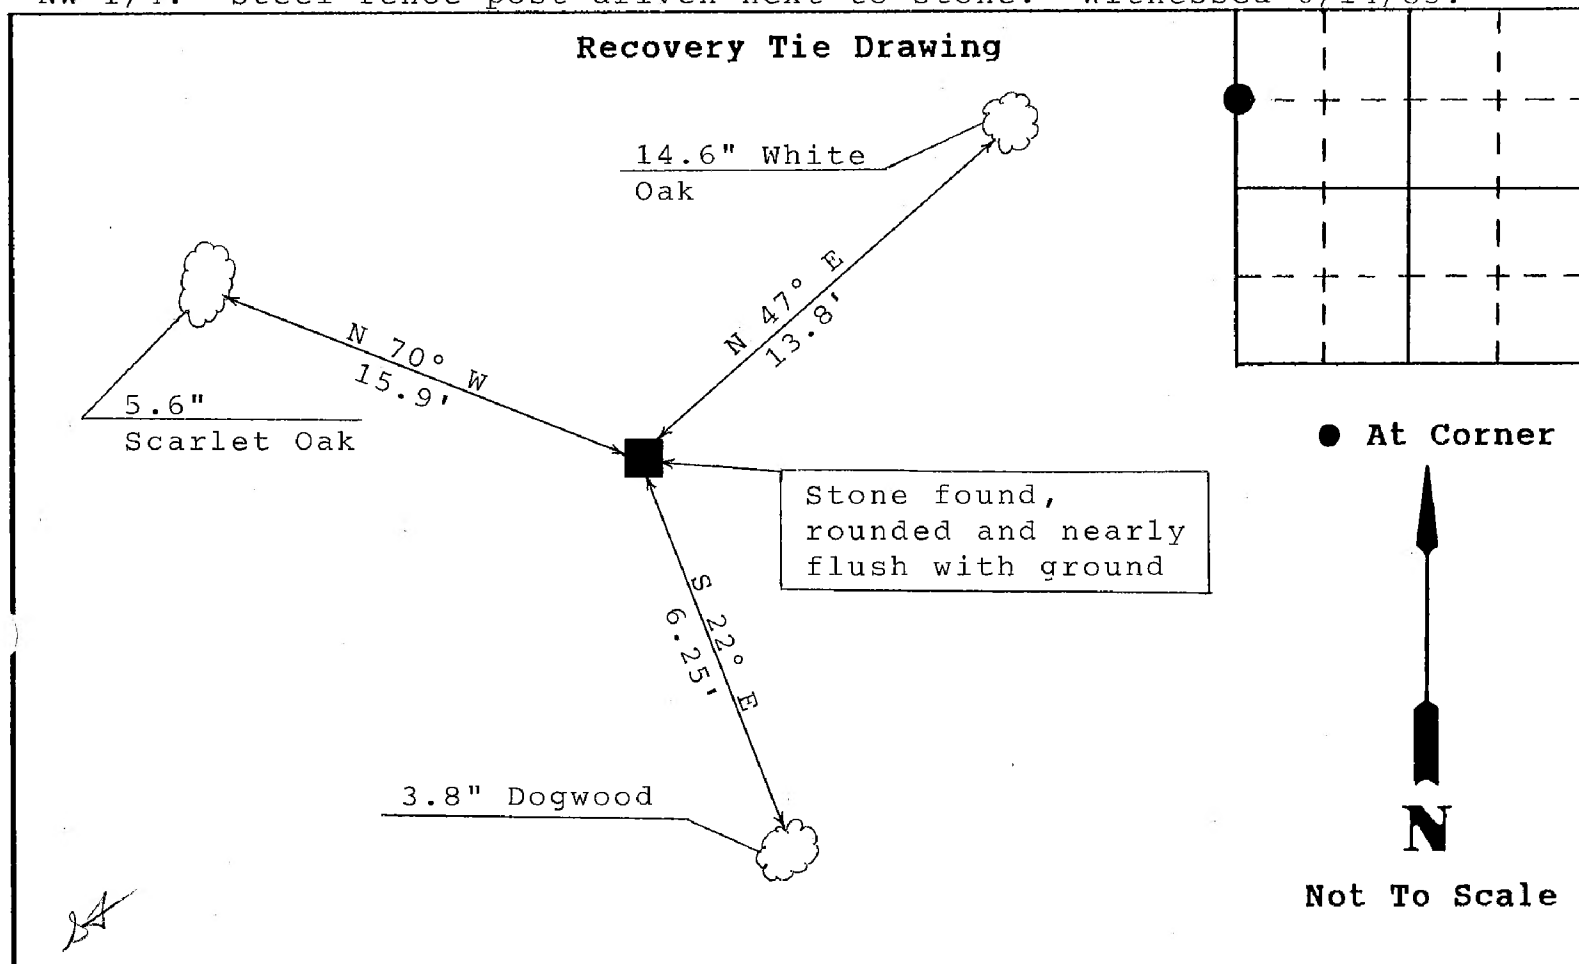

State of Indiana  
County of Monroe

I, Michael W. Friley, County Surveyor, hereby certify  
that this document was prepared under my direction in  
accordance with the provisions of Section 17-3-64-4  
through 17-3-64-8 of the Indiana Code, being Acts of 1965,  
Chapter 319; and the above data is given under my hand and  
seal this 21st day of October, 1993 A.D.

Indiana Registered Land Surveyor No. \_\_\_\_\_ or

Morgan-Monroe State Forest  
United States Government Agency

Bill Hahn, Property Manager  
Title

Space  
Reserved For  
Recording  
Officer

Field Book:

n/a

Page:

n/a

## SECTION 23, T 9 N, R 1 E

1. On June 14, 1983, I located and marked boundaries in this section as follows:

EW line on S side,  $S\frac{1}{2}$ ,  $NW\frac{1}{4}$ . Double boundary signs were placed at turning corners and single boundary signs were placed on continuous lines at  $\frac{1}{4}$  mile marks. Two corner stones were located and witnessed as follows: (1) at 11:45 AM (hot, sunny), SE corner of  $SW\frac{1}{4}$ ,  $NW\frac{1}{4}$  a rectangular stone .7' X .5' exposed .7', 19.2' to a 8.1" chestnut oak bearing  <sup>$N 11^{\circ} W$</sup>   $349^{\circ}$ , 12.7' to a 12.7" chestnut oak bearing  <sup>$S 77^{\circ} E$</sup>   $103^{\circ}$ , 22.7' to a 15.9" scarlet oak bearing  <sup>$S 16^{\circ} W$</sup>   $196^{\circ}$ . (2) at 1:56 PM (hot, sunny), SW corner of  $SW\frac{1}{4}$ ,  $NW\frac{1}{4}$  a rectangular stone 1.0' X .3' exposed .8', 25.6' to a 12.0" scarlet oak bearing  $193^{\circ}$ , 25.4' to a 10.9" scarlet oak bearing  $244^{\circ}$ , 9.6' to a 12.5" black oak bearing  $328^{\circ}$ . A steel fence post was driven by each cornerstone witnessed. Tree lines were painted boundary orange on the state side of the tree.

#1  
drawn  
10-20-93

Bill Hahn, Property Manager

2. On June 29, 1983, I located and marked the NS line of the  $SW\frac{1}{4}$ ,  $NW\frac{1}{4}$ , W side. Double boundary signs were placed at the turning corners. Tree lines were painted boundary orange on the state side of the tree. A corner stone at the NW corner  $SW\frac{1}{4}$ ,  $NW\frac{1}{4}$  was witnessed on 6-14-73 at 2:37 PM as follows: (hot, sunny); stone was rounded and nearly flush to the ground. The stone measured .8' X .3' and was exposed .15', 13.8' to a 14.6" white oak bearing  $047^{\circ}$ , 6.25' to a 3.8" dogwood bearing  <sup>$S 22^{\circ} E$</sup>   $158^{\circ}$ , 15.9' to a 5.6" scarlet oak bearing  <sup>$N 70^{\circ} W$</sup>   $290^{\circ}$ . A steel fence post was driven next to the stone on 6-29-83.

Bill Hahn, Property Manager